




Agilent 86120B, 86120C, 86122A Multi-Wavelength Meters Technical Specifications

March 2006

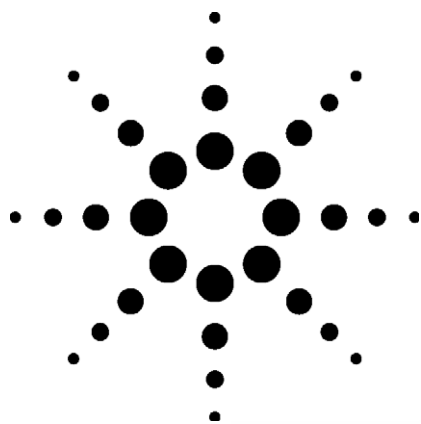

Agilent multi-wavelength meters are Michelson interferometer-based instruments that measure wavelength and optical power of laser light over a specified wavelength range. Simultaneous measurements of multiple laser lines are performed allowing measurements of DWDM signals and multiple lines of Fabry-Perot lasers. Each laser line is assumed to have a linewidth (including modulation sidebands) of less than:

- 10 GHz for the 86120B,
- 5 GHz for the 86120C and
- 2.5 GHz for the 86122A.

This technical specifications sheet describes the measurement accuracy and operating conditions of the Agilent 86120B, 86120C and 86122A Multi-Wavelength Meters. The **specifications** apply to all functions over the temperature range of 0 to 55 °C and relative humidity <95% (unless otherwise noted). All specifications apply after the instrument's temperature has been stabilized after 15 minutes continuous operation, and when the instrument is in NORMAL UPDATE mode (86120B and 86120C).



Agilent Technologies

Definitions of Terms

Characteristics and Specifications

The distinction between specifications and characteristics is described as follows:

- *Specifications* describe warranted performance.
- *Characteristics* provide useful, but non-warranted information about the functions and performance of the instrument.

Wavelength

- *Range* refers to the allowable wavelength range of the optical input signal.
- *Absolute accuracy* indicates the maximum wavelength error over the allowed environmental conditions.
- *Differential accuracy* indicates the maximum wavelength error in measuring the wavelength difference between two signals that are simultaneously present.
- *Minimum resolvable separation* indicates the minimum wavelength separation of two laser lines input required to measure each wavelength simultaneously. Two laser lines closer in wavelength than the minimum resolvable separation are not resolved and one average wavelength is displayed.
- *Display resolution* indicates the minimum incremental change in displayed wavelength.

Power

- *Calibration accuracy* indicates the maximum power calibration error at the specified wavelengths over the allowed environmental conditions.
- *Flatness* refers to the maximum amplitude error in a measurement between two lines that are separated in wavelength by no more than the specified amount.
- *Linearity* indicates the maximum power error in measuring the change in power of one laser line.
- *Polarization dependence* indicates the maximum displayed power variation as the polarization of the input signal is varied.
- *Display resolution* indicates the minimum incremental change in displayed power.

Sensitivity

- *Sensitivity* is defined as the minimum power level of a single laser line input to measure wavelength and power accurately. A laser line with less than the minimum power may be measured but with reduced wavelength and power accuracy. For multiple laser lines input, sensitivity may be limited by total input power.

Selectivity

- *Selectivity* indicates the ability to measure the wavelength and power of a weak laser line in the proximity of a specified stronger laser line and separated by the specified amount.

Input Power

- *Maximum displayed level* indicates the maximum total input power (total of all laser lines present) to accurately measure wavelength and power.
- *Maximum safe input power* indicates the maximum total input power (total of all laser lines present) to avoid permanent optical damage to the instrument.

Maximum Number of Lines Input

- *Maximum number of lines input* is the maximum number of displayed lines. If more than the specified number of lines are input, only the longest wavelength lines are displayed.

Input Return Loss

- *Input return loss* indicates the optical power reflected back to the user's fiber cable relative to the input power. It is limited by the return loss of the front panel connector, and assumes the user's connector is good.

Measurement Cycle Time

- *Measurement cycle time* refers to the cycle time when measuring wavelength and power of laser lines. Specific advanced applications may require longer cycle times.

Specifications

	86120B	86120C	86122A	Notes
Wavelength				For lines separated by less than the specified amount, wavelength accuracy is reduced.
Range	700-1650 nm (182-428 THz)	1270-1650 nm (182-236 THz)	1270-1650 nm (182-236 THz)	
Absolute Accuracy	±3 ppm	±2 ppm	±0.5 ppm (Opt.001) +0.2 ppm (Opt.002)	
at 1550 nm	+0.005 nm	+0.003 nm	+0.75 pm (Opt. 001), ±0.3 pm (Opt. 002)	
at 1310 nm	+0.004 nm	+0.003 nm	+0.65 pm (Opt. 001), ±0.3 pm (Opt. 002)	
for laser lines separated by	≥30 GHz	≥15 GHz	≥10 GHz	
Differential Accuracy ¹	±2 ppm	±1 ppm	±0.25 ppm (Opt. 001) ±0.15 ppm (Opt. 002)	
Minimum Resolvable Separation ¹ (equal power lines input)	20 GHz	10 GHz	5 GHz	
at 1550 nm	0.16 nm	0.08 nm	0.04 nm	
at 1310 nm	0.11 nm	0.06 nm	0.03 nm	
for laser lines separated by	≥30 GHz	≥15 GHz	≥10 GHz	
Display Resolution	0.001 nm		0.0001 nm	
Fast update mode	0.01 nm		N/A	
Units	nm (vacuum or standard air), cm ⁻¹ , THz			
Power				
Calibration Accuracy	±0.5 dB (at ±30 nm from 780, 1310, and 1550 nm)	±0.5 dB (at ±30 nm from 1310 and 1550 nm)		30 nm from any wavelength
Flatness ¹	±0.2 dB (1200 to 1600 nm) ±0.5 dB (700 to 1650 nm)	±0.2 dB (1270 to 1600 nm) ±0.5 dB (1270 to 1650 nm)		
Linearity	±0.3 dB (1200 to 1600 nm)	±0.3 dB (1270 to 1600 nm)		Lines above -30 dBm
Polarization Dependence	±0.5 dB (1200 to 1600 nm) ±1.0 dB ¹ (700 to 1650 nm)	±0.5 dB (1270 to 1600 nm) ±1.0 dB ¹ (1600 to 1650 nm)		Characteristic noise floor -60 dBm
Display Resolution	0.01 dB			
Units	dBm, mW, μW			
Sensitivity ²				
Single Line Input	-20 dBm (700 to 800 nm) -25 dBm (800 to 1200 nm) -40 dBm (1200 to 1600 nm) -30 dBm (1600 to 1650 nm)	-40 dBm (1270 to 1600 nm) -30 dBm (1600 to 1650 nm)	-32 dBm (1600 to 1650 nm) -22 dBm (1600 to 1650 nm)	
Multiple Lines Input ¹³	30 dB below total input power, but not less than single line input sensitivity			
Selectivity ¹	25 dB spacing ≥100 GHz 10 dB spacing ≥30 GHz	25 dB spacing ≥50 GHz 10 dB spacing ≥15 GHz	25 dB spacing ≥90 GHz 10 dB spacing ≥10 GHz	
Input Power				
Maximum Displayed Level	+10 dBm			sum of all lines input
Maximum Safe Input Level	+18 dBm			
Return Loss				
With Non-Angled (PC) Connectors	35 dB			
With Angled (PC) Connectors	50 dB			
(Option 022)				
Measurement Cycle Time	1.0 s		0.5 s	Data Logging and sorting by any parameter are included in the 86122A.
Maximum Number of Lines	100	200	1000 ⁴	
Measurement Modes	List by wavelength table, list by power table, signal wavelength and power, average wavelength and total power			
Delta Modes	Delta wavelength, delta power, delta wavelength and power			

Specifications (cont'd)

	86120B	86120C	86122A	Notes
Built in Automatic Measurement Applications				
Signal to Noise Ratio ^{1,6} Channel Spacing ≥200 GHz Channel Spacing ≥100 GHz Channel Spacing ≥50 GHz	>35 dB with 100 averages	>35 dB with 100 averages >27 dB with 100 averages	>35 dB with 100 averages >27 dB with 100 averages	0.1 nm noise bandwidth. Lines above –25 dBm.
Drift	Maximum, minimum, total drift (max-min) of wavelengths and powers over time			
Fabry-Perot Characterization		Mean wavelength, peak wavelength, mode spacing full-width half maximum, peak amplitude total power, sigma		
Coherence Length ¹	Fabry-Perot lasers, 1 to 200 mm coherence length, accuracy to within ±5%, 0.75 cycle time			
Additional Features	Power offset, power bars (on or off), user adjustable peak excursion and peak threshold, user adjustable start and stop wavelength limits, graphical display, save and recall instrument states.			
Inputs/Outputs				
Optical Input	9/125 μm single-mode fiber			
Rear Panel Connectors	GPIB, parallel printer port, AC line		LAN, PS/2 for Keyboard & Mouse, SVGA for external monitor, GPIB, parallel printer port, AC Line, optional optical input	
Dimensions and Weight				
Dimensions	140 mm high x 340 mm wide x 465 mm deep (5.5 in x 13.4 in x 18.3 in) 9 kg (19 lb)		138 h x 425 w x 520 mm d (5.2 in x 16.7 in x 20.5 in) 14.5 kg (32 lb)	
Environmental				
Operational Temperature	0°C to +55°C			15°C to 35°C, <75% R.H. at 35°C for 86122A Opt.002
Humidity ⁵	<95% R.H. at +40°C, 5 day soak			
Shock ⁵	300 g		120 g	
Vibration ⁵	5 g rms 0.75 g (0 to peak)		2 g rms 0.5 g (0 to peak)	
EMC	Conducted and radiated interference is in compliance with CISPR Pub 11, IEC 801-2, IEC 801-3, IEC 801-4 and IEC 555-2			
Storage Temperature	–40°C to +70°C			
Humidity ⁵	90% R.H. at +65°C for 24 hrs.		95% R.H. at +45°C, 5 day cycle	
Power Requirements				
Voltage and frequency Maximum Power	100 / 115 / 230 / 240 V~, 50 / 60 Hz 70 watts max (125 VA max)		100 / 115 / 230 / 240 V~, 50 / 60 Hz 310 VA max	

¹ Characteristic

² Contact Agilent Technologies for availability of special instruments with higher sensitivity.

⁴ For 86122A number of laser lines may be limited by signal power requirements for accurate wavelength measurements.

⁵ Type tested means tested, but not warranted, for continuous operation.

⁶ At 1550 nm

Ordering Information

For the most up-to-date ordering information, please contact your Agilent sales representative or visit our website at:
www.agilent.com/comms/lightwave

86120B/C Multi-Wavelength Meter

Optical Connectors

86120x-012	FC Connector (default)
86120x-013	DIN Connector
86120x-014	ST Connector
86120x-017	SC Connector
86120x-020	Straight (non-angled) Contact Interface-PC
86120x-022	Angled Contact Interface-APC

Fixed External 10 dB Attenuators

86120x-412	Attenuator with FC/PC Connector (must be ordered with 86120x-020 option)
86120x-417	Attenuator with FC/APC Connector (must be ordered with 86120x-022 option)

Accessories

86120x-AXE	Rack Flange Kit with Handles
86120x-IA4	Rack Flange Kit without Handles
86120x-UK5	Nylon Carrying Case with Shoulder Strap
86120x-UK6	Commercial Calibration Certificate with Test Data
86120x-UK7	Hard Carrying Case

Documentation

86120x-ABA	English Operation Manual (default)
86120x-OB0	Do not include an Operation Manual



86122A Multi-Wavelength Meter

Performance Options

86122A-001	Standard Performance (default)
86122A-002	High Accuracy Performance

Optical Connectors

86122A-020	Straight (non-angled) Contact Interface-PC (default)
86122A-022	Angled Contact Interface-APC
86122A-400	Front Panel Fiber Input (default)
86122A-401	Rear Panel Fiber Input
81000FI	FC Connector (default)
81000KI	SC Connector
81000SI	DIN Connector

Fixed External 10 dB Attenuators

86122A-412	Attenuator with FC/PC Connector (must be ordered with 86122A 020 option)
86122A-417	Attenuator with FC/APC Connector (must be ordered with 86122A-022 option)

Accessories

86122A-1CM	Rack Mount Kit without Handles
86122A-1CN	Handle Kit
86122A-1CP	Rack Mount Kit plus Handles
86122A-UK6	Commercial Calibration Certificate with Test Data

Documentation

86122A-ABA	English Operation Manual (default)
86122A-OB0	Do not include an Operation Manual

Agilent Technologies' Test and Measurement Support, Services, and Assistance

Agilent Technologies aims to maximize the value you receive, while minimizing your risk and problems. We strive to ensure that you get the test and measurement capabilities you paid for and obtain the support you need. Our extensive support resources and services can help you choose the right Agilent products for your applications and apply them successfully. Every instrument and system we sell has a global warranty. Support is available for at least five years beyond the production life of the product. Two concepts underlie Agilent's overall support policy: "Our Promise" and "Your Advantage."

Our Promise

Our Promise means your Agilent test and measurement equipment will meet its advertised performance and functionality. When you are choosing new equipment, we will help you with product information, including realistic performance specifications and practical recommendations from experienced test engineers. When you use Agilent equipment, we can verify that it works properly, help with product operation, and provide basic measurement assistance for the use of specified capabilities, at no extra cost upon request. Many self-help tools are available.

Your Advantage

Your Advantage means that Agilent offers a wide range of additional expert test and measurement services, which you can purchase according to your unique technical and business needs. Solve problems efficiently and gain a competitive edge by contracting with us for calibration, extra-cost upgrades, out-of-warranty repairs, and on-site education and training, as well as design, system integration, project management, and other professional engineering services. Experienced Agilent engineers and technicians worldwide can help you maximize your productivity, optimize the return on investment of your Agilent instruments and systems, and obtain dependable measurement accuracy for the life of those products.

By Internet, phone, or fax, get assistance with all your test & measurement needs

Online assistance:

www.agilent.com/comms/lightwave

Online assistance:

<http://www.agilent.com/comms/octspectral>

Phone or Fax

United States:

(tel) 1 800 452 4444
(fax) 1 800 829 4433

Canada:

(tel) 1 877 894 4414
(fax) 1 800 746 4866

Europe:

(tel) (31) 20 547 2111
(fax) (31) 20 547 2190

Japan:

(tel) 120 421 345
(fax) 120 421 678

Latin America:

(tel) +55 11 4197 3600
(fax) +55 11 4197 3800

Australia:

(tel) 800 629 485
(fax) 800 142 134

Asia Pacific:

(tel) +852 800 930 871
(fax) +852 800 908 476

Product specifications and descriptions in this document subject to change without notice.

Copyright © 2006 Agilent Technologies
March 2006

5988-5422EN



Agilent Technologies